Tech Note 922

Some ActiveX Controls NOT Supported in InTouch 2012 R2 (Version 10.6)

All Tech Notes, Tech Alerts and KBCD documents and software are provided "as is" without warranty of any kind. See the Terms of Use for more information.

Topic#: 002737

Created: February 2013

Introduction

This Tech Note lists some of the ActiveX Controls that are not supported on InTouch version 2012 R2 (10.6).

Due to the Data Execution Prevention (DEP) feature of Windows 7 or Windows 2008 R2 operating systems, any ActiveX Control built with ATL version 7.1 or earlier will fail to host, or will have unpredictable behaviors in InTouch 10.6 WindowMaker™ or WindowViewer™ running on Windows 7 or Windows 2008 R2. In this case, WindowMaker and WindowViewer do not display the embedded ActiveX Controls developed with ATL version 7.1 or earlier.

A warning message Fail to Create OCX control with error 126: Please contact technical support. is logged in the SMC logger.

Application Versions

Wonderware InTouch 2012 R2 (version 10.6)

Cause

The reason is because some ActiveX Controls that still have an old version of ATL when running on .NET 4.0. The controls do not work under .NET 4.0, and because the new ASP install includes .NET 4.0, there is a possibility, depending on how the control was written, that you can encounter issues with the Control.

Resolution

The recommended solution to this issue is to re-compile the ActiveX Controls with ATL version that is greater than 7.1. If you cannot recompile the ActiveX Control, the following workarounds are effective:

 Disable Data Execution Prevention feature (DEP) (http://support.microsoft.com/kb/875352?wa=wsignin1.0) on Window 7 or Window 2008 R2.

OR

- Enable the following registry key by doing the following:
- 1. Create a **String** value registry entry called **AllowLegacyActiveXControls** under the following key **HKLM\Software\Wonderware\InTouch** (32 bit) or **HKML\Software\Wow6432Node\Wonderware\InTouch** (64-bit)

2. Set the value of AllowLegacyActiveXControls to:
AllowLegacyActiveXControls = 3ca10642-6728-4e22-97da-135a6df38a5c

Note: The above registry key will work for any ActiveX Controls that are developed with ATL version 7.1 or earlier.

The following table lists some of the ActiveX Control that are not supported on InTouch 10.6:

ActiveX Control	Registry Entry "AllowLegacyActiveXControls" Required	Related Product
TimeBased	Yes	DASTestServer
Tabular Data Control(TDCCtl)	Yes	N/A
SysColorCtrl	Yes	System Ctrl
STREAMEDLATEDATA	Yes	DASTestServer
Signal	Yes	DASTestServer
ROOT	Yes	DASTestServer
QIChart Class	Yes	QIAnalyst 8.0 SP2
QIDBConnection Class	Yes	QIAnalyst 8.0 SP2
InControl Data Srouce Control	Yes	InControl 7.11 SP2
InControl Runtime Access Control	l Yes	InControl 7.11 SP2
PID Control	Yes	InControl 7.11 SP2

B. Shah

Tech Notes are published occasionally by Wonderware Technical Support. Publisher: Invensys Systems, Inc., 26561 Rancho Parkway South, Lake Forest, CA 92630. There is also technical information on our software products at Wonderware Technical Support.

For technical support questions, send an e-mail to wwsupport@invensys.com.



© 2013 Invensys Systems, Inc. All rights reserved. No part of the material protected by this copyright may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying, recording, broadcasting, or by anyinformation storage and retrieval system, without permission in writing from Invensys Systems, Inc.

Some ActiveX Controls NOT Supported in InTouch 2012 R2 (Version 10.6)
Terms of Use.