

Software Name: Firmware for EDS-408A Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.8	Build_17051216	N/A	EDS-408A-EIP, EDS-408A-SS-SC-T, EDS-408A-3S-SC-48, EDS-408A-EIP-T, EDS-408A-2M1S-SC-T, EDS-408A-3S-SC, EDS-408A-MM-SC, EDS-408A-1M2S-SC-T, EDS-408A-SS-SC, EDS-408A-3S-SC-48-T, EDS-408A-3M-ST-T, EDS-408A-2M1S-SC, EDS-408A-MM-SC-T, EDS-408A-MM-ST-T, EDS-408A-3M-ST, EDS-408A-T, EDS-408A-1M2S-SC, EDS-408A-MM-ST, EDS-408A-3M-SC-T, EDS-408A, EDS-408A-3S-SC-T, EDS-408A-3M-SC	<p>New Features: N/A</p> <p>Enhancements: N/A</p>	<p>Bugs Fixed: 1. User account login authentication error in menu console mode.</p> <p>Changes: N/A</p>	N/A

Software Name: Firmware for EDS-408A Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.7	Build_17031513	N/A	EDS-408A Series	<p>New Features: N/A</p> <p>Enhancements:</p> <ol style="list-style-type: none"> 1. Add warning message when default password was not changed 2. Encrypt security Keys in user interface 	<p>Bugs Fixed:</p> <ol style="list-style-type: none"> 1. Cross-site scripting vulnerability. 2. Denial of Service attack vulnerability. 3. Privilege escalation vulnerability. 4. SSL v2/v3 vulnerability in HTTPS. 5. Web console cannot be accessed due to SNMP get bulk. 6. Specific CLI command caused the switch to reboot with default settings. 7. Add a new VLAN will change IGMP querier state from disable to enable. 8. Saving configurations to ABC-01 cannot be performed via IE browser. 9. Rate limit could not be set in web UI. 10. Telnet hangs after SSH disabled. 11. Corrected RSTP edge definition in exported configuration file. 12. Corrected authorization of Radius/TACACS+ login. 13. Corrected RSTP Auto-Edge behavior. 14. The system sometimes rebooted after a period of operation when PROFINET was enabled. <p>Changes: N/A</p>	N/A

Software Name: Firmware for EDS-408A Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.5	Build_15080711	N/A	EDS-408A Series	<p>New Features: N/A</p> <p>Enhancements: N/A</p>	<p>Bugs Fixed:</p> <ol style="list-style-type: none"> 1. Turbo Ring/Turbo Chain redundant ports state randomly changed from forwarding to blocking. 2. Turbo Ring/Turbo Chain operated unstably after the switch performs a warm start. 3. The RSTP function was incompatible with some third party devices. 4. The switch failed to respond to the SNMP request. 5. The switch packet counter information error via SNMP polling or web user interface display. 6. Switch configuration export error via CLI. 7. Web user interface Diagnosis > Ping page is vulnerable to XSS attack. 8. Switch sometimes rebooted when using a special URL to attack web user interface. 9. User account privileges can be changed by Firefox browser web developer plugin. <p>Changes: N/A</p>	None
v3.4	Build_14121010	N/A	EDS-408A Series	<p>New Features: N/A</p> <p>Enhancements: N/A</p>	<p>Bugs Fixed:</p> <ol style="list-style-type: none"> 1. Web user interface display errors under Java 8 environments. <p>Changes: N/A</p>	N/A
v3.3	N/A	N/A	EDS-408A Series	<p>New Features: N/A</p> <p>Enhancements:</p> <ol style="list-style-type: none"> 1. Added web interface for loop-protection enable/disable. 2. Added web interface/CLI/SNMP for NTP/SNTP client settings. 	<p>Bugs Fixed:</p> <ol style="list-style-type: none"> 1. Failed to log in using CLI mode when password contained special characters. 2. Hybrid VLAN lacked SNMP MIB object. 3. Configuration import was restricted if the system name was too long. 4. DIP switch "Coupler" On/Off is malfunction. <p>Changes: N/A</p>	N/A

Software Name: Firmware for EDS-408A Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.1	N/A	N/A	EDS-408A Series	<p>New Features: N/A</p> <p>Enhancements:</p> <ol style="list-style-type: none"> 1. Passed ODVA EtherNet/IP certificate. 2. Added some minor SNMP OIDs. 3. Enhanced multicast performance. 4. Added version number in the MIB file. 	<p>Bugs Fixed:</p> <ol style="list-style-type: none"> 1. NTP did not synchronize time in default settings. 2. NTP client function did not work with Windows XP NTP server. 3. Firmware Upgrade Failed when IEEE 802.1x was enabled. 4. Switch rebooted when receiving IGMP v3 packets (commonly used in Windows 7). <p>Changes: N/A</p>	N/A
v3.0	N/A	N/A	EDS-408A Series	<p>New Features:</p> <ol style="list-style-type: none"> 1. RSTP-2004. 2. NTP Server/Client. 3. Hybrid VLAN. 4. Command Line Interface. 5. EtherNet/IP. 6. Egress rate limit. 7. Unknown unicast filtering. 8. CPU loading monitoring. 9. Changed IP address without rebooting. 10. DHCP Discover retry configuration. 11. GARP timer adjustment. 12. Loop-protection. 13. Link Fault Shutdown (Disable mode in "Rate Limit" function). <p>Enhancements: N/A</p>	<p>Bugs Fixed: N/A</p> <p>Changes: N/A</p>	N/A

Software Name: Firmware for EDS-408A Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v2.7	N/A	N/A	EDS-408A Series	New Features: 1. Added IGMP Snooping function. 2. Added IEEE 802.1Q VLAN function. Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A
v2.6	N/A	N/A	EDS-408A-MM-ST-T, EDS-408A-T, EDS-408A-3S-SC-48-T, EDS-408A-3M-SC-T, EDS-408A-EIP, EDS-408A-2M1S-SC-T, EDS-408A-3M-ST-T, EDS-408A-EIP-T, EDS-408A-1M2S-SC-T, EDS-408A-MM-SC-T, EDS-408A, EDS-408A-MM-ST, EDS-408A-MM-SC, EDS-408A-SS-SC, EDS-408A-3M-ST, EDS-408A-3M-SC, EDS-408A-3S-SC, EDS-408A-3S-SC-48, EDS-408A-1M2S-SC, EDS-408A-2M1S-SC, EDS-408A-SS-SC-T, EDS-408A-3S-SC-T	New Features: 1. Supports TurboPack™ 2009 (Add the new managed functions of Turbo Chain, IPv6, Modbus/TCP, IEEE 1588 PTP, SNMP Inform, LLDP, DHCP Option 82, Firefox, and SSH) Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	For products with firmware prior to v2.6, users must upgrade to v2.6 before upgrading to the latest v3.X firmware.
v2.2	N/A	N/A	EDS-408A Series	New Features: 1. New firmware release for the EDS-408A Series with three fiber ports. Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A
v2.1	N/A	N/A	EDS-408A Series	New Features: 1. Added new Turbo Ring ("Turbo Ring V2") function. 2. Added new Ring Coupling function. 3. Added Daylight Saving function. Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A

Software Name: Firmware for EDS-408A Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v1.3	N/A	N/A	EDS-408A Series	New Features: 1. Added Syslog Function. 2. Added Restart Function. 3. Supports ABC-01. 4. Changed default setting of Flow Control from Enable to Disable. Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A
v1.1	N/A	N/A	EDS-408A Series	New Features: 1. New firmware release for the EDS-408A Series. Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A