

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.8	Build_17041115	N/A	EDS-508A-MM-SC, EDS-508A-SS-SC-T, EDS-508A-BDS-508A-T, EDS-508A-SS-SC-80-T, EDS-508A-SS-SC, EDS-508A-MM-ST-T, EDS-508A-MM-ST-T, EDS-508A-MM-ST-T, EDS-508A-SS-SC-80	Encrypt security Keys in user interface Enhance RSTP compatibility	Bugs Fixed: 1. Cross-site scripting vulnerability. 2. Denial of Service attack vulnerability. 3. Privilege escalation vulnerability. 4. SSL v2/v3 vulnerability in https. 5. Web console cannot be accessed due to SNMP get bulk. 6. Specific CLI command cause switch reboot with default settings. 7. Add a new VLAN will change IGMP querier state from disable to enable. 8. Saving configuration to ABC-01 cannot be performed via IE browser. 9. Rate limit cannot be set in web UI. 10. Telnet hangs after SSH disabled. 11. Correct RSTP edge definition in exported configuration file. 12. Correct authorization of Radius/TACACS+ login. 13. Correct RSTP Auto-Edge behavior. 14. After upgrade firmware, the system maybe warm start when the user login the switch. Changes: N/A	N/A
v3.4	Build_14121010	N/A	EDS-508A	New Features: N/A Enhancements: N/A	Bugs Fixed: 1. Web user interface display errors under Java 8 environment Changes: N/A	N/A

Form number: HQ-PD.450 Version: v3.8 Page 1 of 4



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.3	N/A	N/A	EDS-508A	New Features: N/A Enhancements: 1. Added web interface for loop-protection enable/disable. 2. Added web interface for SSH/SSL key generation. 3. Added web interface/CLI/SNMP for NTP/SNTP client settings.	Bugs Fixed: 1. Login failed in CLI mode when password included special characters. 2. Hybrid VLAN lacked SNMP MIB object. 3. IEEE 1588 PTP could not function correctly. 4. Importing configurations was restricted if the system name was too long. 5. Login authentication failed if the radius server did not support privilege levels assignment. 6. DIP switch "Coupler" On/Off malfunctioned. Changes: N/A	N/A
v3.1	N/A	N/A	EDS-508A	New Features: N/A Enhancements: 1. Passed ODVA EtherNet/IP certificate. 2. Added some minor SNMP OIDs. 3. Enhanced multicast performance. 4. Added version number in MIB file.	Bugs Fixed: 1. NTP could not synchronize time in the default settings. 2. NTP client function did not work with Windows XP NTP server. 3. Firmware upgrade failed when IEEE 802.1x was enabled. 4. Switch rebooted when receiving IGMP v3 packets (commonly used in Windows 7). Changes: N/A	N/A

Form number: HQ-PD.450 Version: v3.8 Page 2 of 4



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.0	N/A	N/A	EDS-508A	New Features: 1. RSTP-2004 2. MSTP 3. NTP Server/Client 4. IEEE 1588 PTP V2 5. RADIUS and TACACS+ for user login authentication 6. RADIUS for 802.1x port authentication 7. Hybrid VLAN 8. Command Line Interface 9. EtherNet/IP 10. Egress rate limit 11. Unknown unicast filtering 12. CPU loading monitoring 13. Change IP without reboot 14. DHCP Discover retry configuration 15. GARP timer adjustment 16. Loop-protection 17. Link Fault Shutdown (Disable mode in "Rate Limit" function) Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A
v2.6	N/A	N/A	EDS-508A-MM-ST, EDS-508A- T, EDS-508A-SS-SC-T, EDS- 508A-SS-SC-80-T, EDS-508A- MM-SC, EDS-508A-SS-SC-80, EDS-508A-SS-SC, EDS-508A- MM-SC-T, EDS-508A-MM-ST- T, EDS-508A	New Features: N/A Enhancements: 1. Enhance Turbo Chain function	Bugs Fixed: N/A Changes: N/A	For products with firmware prior to v2.6, users must upgrade to v2.6 before upgrading to the latest v3.X firmware.

Form number: HQ-PD.450 Version: v3.8 Page 3 of 4



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v2.5	N/A	N/A	EDS-508A	New Features: 1. Supports TurboPack™ 2009 (added new functions for Turbo Chain, IPv6, Modbus/TCP, IEEE 1588 PTP, SNMP Inform, LLDP, DHCP Option 82, Firefox, and SSH) Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A
v2.1	N/A	N/A	EDS-508A	New Features: 1. Added new Turbo Ring ("Turbo Ring V2") function 2. Added new Ring Coupling function 3. Added Daylight Saving function Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A
v1.3	N/A	N/A	EDS-508A	New Features: 1. Syslog function 2. Restart function Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A
v1.2	N/A	N/A	EDS-508A	New Features: 1. New firmware release for the EDS-508A Series Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A

Form number: HQ-PD.450 Version: v3.8 Page 4 of 4