

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.8	17041115	N/A	EDS-616 Series	TOPIAULI DASSWOLO WAS NOL CHANDED.	 Bugs Fixed: 1. Cross-site scripting vulnerability. 2. Denial of Service attack vulnerability. 3. Privilege escalation vulnerability. 4. SSL v2/v3 vulnerability in HTTPS. 5. Web console cannot be accessed due to SNMP get bulk. 6. Specific CLI command cause switch reboot with default settings. 7. Add a new VLAN will change IGMP querier state from disable to enable. 8. Can not save configurations to the ABC-01 via IE browser. 9. Rate limit could not be set in web UI. 10. PTP timestamp error in announce Message. 11. Telnet hangs after SSH disabled. 12. Corrected RSTP edge definition in exported configuration file. 13. Corrected authorization of Radius/TACACS+ login. 14. Display issue with JAVA applet. 15. Corrected RSTP Auto-Edge behavior. 16. System rebooted after specific CLI command. Changes: N/A 	N/A
v3.4	15011510	N/A	EDS-616 Series	New Features: N/A Enhancements: N/A	Bugs Fixed: 1. Web user interface display errors under Java 8 environments. Changes: N/A	N/A



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.3	13092410	N/A	EDS-616 Series	2. Added web Interface for SSH/SSL key generation. 3. Added SNMP MIB for SFP DDM	 Bugs Fixed: 1. Login failed in the CLI mode when the password contained a special character. 2. Hybrid VLAN lacked SNMP MIB object. 3. SFP DDM (Diagnostics) displayed inaccurate values. 4. IEEE 1588 PTP did not function correctly. 5. Far-end fault failed on 100 M fiber port. 6. Importing configurations was restricted if the system name was too long. 7. Login authentication failed if the radius server did not support privilege levels assignment. 8. DIP switch "Coupler" On/Off malfunctioned. Changes: 	N/A
v3.1	12092817	N/A	EDS-616 Series	New Features: N/A Enhancements: 1. Passed ODVA EtherNet/IP certificate. 2. Added some minor SNMP OIDs. 3. Enhanced multicast performance. 4. Added version number in MIB file.	 Bugs Fixed: 1. NTP could not synchronize time in default settings. 2. NTP client function could not work with Windows XP NTP server. 3. Firmware Upgrade Failed when IEEE 802.1x was enabled. 4. The Switch rebooted when receiving IGMP v3 packets (commonly used in Windows 7). Changes: N/A 	N/A



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.0	N/A	N/A	EDS-616 Series	1. RSTP-2004. 2. MSTP. 3. NTP Server/Client 4.SW 1588	Bugs Fixed: 1. Event log display "module 3 & 4 inserted" issue. Changes: N/A	N/A
v1.2	N/A	N/A	EDS-616 Series	2. Supports the CM-600-4TX-PTP module for IEEE 1588 v1/v2 protocol.	Bugs Fixed: N/A Changes: N/A	N/A



Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v1.1	N/A	N/A	EDS-616 Series	1. Added hot swappable function for supporting hot-plug interface modules.	Bugs Fixed: 1. After the time setting of Age Time was changed, the function did not work normally. Changes: N/A	N/A
v1.0	N/A	N/A	EDS-616 Series	 New firmware release for EDS-616 Series. Supports TurboPack[™] 2009 (add new functions for Turbo Chain, IPv6 	Bugs Fixed: N/A Changes: N/A	N/A