

Software Name: Firmware for PT-G7509 Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.8	Build_17041117	N/A	PT-G7509 Series	<p>New Features: N/A</p> <p>Enhancements:</p> <ol style="list-style-type: none"> 1. Added warning message when default password was not changed. 2. Encrypted security keys in user interface. 3. Enhanced RSTP compatibility. 	<p>Bugs Fixed:</p> <ol style="list-style-type: none"> 1. Cross-site scripting vulnerability. 2. Denial of service attack vulnerability. 3. Privilege escalation vulnerability. 4. SSL v2/v3 vulnerability in HTTPS. 5. Web console cannot be accessed when the SNMP get bulk service is running. 6. Specific CLI command caused the switch to reboot with default settings. 7. Adding a new VLAN will change IGMP querier state from disabled to enabled. 8. Saving configurations to ABC-01 could not be performed via IE browser. 9. Corrected RSTP auto-edge behavior. 10. Rate limit could not be set in web UI. 11. PTP timestamp error in announce message. 12. System rebooted after specific CLI command. 13. Display issue with JAVA applet. 14. Telnet hangs after SSH disabled. 15. Corrected RSTP edge definition in exported configuration file. 16. Correct authorization of Radius/TACACS+ login. <p>Changes: N/A</p>	N/A

Software Name: Firmware for PT-G7509 Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v3.3	N/A	N/A	PT-G7509 Series	<p>New Features: N/A</p> <p>Enhancements: N/A</p>	<p>Bugs Fixed:</p> <ol style="list-style-type: none"> 1. Could not access Web server via IPv6. 2. In CLI mode, import/export CLI errors when rate limiting is port disabled. 3. Fixed MDI/MDIX incorrect issue in web display. 4. Fixed SNMP query will timeout issue when 64 VLAN groups and 256 IGMP joined groups are configured. 5. Fixed Rate Limiting configure issue. 6. Fixed MIB file compile warning issue. 7. Fixed MIB warm start name error issue. 8. Fixed MIB missing DDM and Loop Protection function issue. 9. Corrected the description of Modbus/TCP in MIB. 10. Fixed no Rate Limiting Control Mode settings in exported config file. 11. After CLI config saving, the Rate Limiting setting became empty. 12. Fixed Ping fail issue after changing IP continuously. 13. Fixed SNMP vlanEntry is displayed in characters and not a number. 14. Fixed CPU loading issue under 256 IGMP join packet. <p>Changes: N/A</p>	N/A
v3.1	N/A	N/A	PT-G7509 Series	<p>New Features: N/A</p> <p>Enhancements:</p> <ol style="list-style-type: none"> 1. Passed ODVA EtherNet/IP certificate 2. Added some minor SNMP OIDs. 3. Enhanced multicast performance. 4. Added version number in MIB file. 	<p>Bugs Fixed:</p> <ol style="list-style-type: none"> 1. NTP did not synchronize time in default settings. 2. NTP client function did not work with Windows XP NTP server. 3. Firmware Upgrade Failed when IEEE 802.1x was enabled. 4. Switch reboots when receiving IGMP v3 packets (commonly used in Windows 7). <p>Changes: N/A</p>	N/A

Software Name: Firmware for PT-G7509 Series

Version No.	Build Date No./ Release Date	Supported OS	Apply to Models	New Features/ Enhancements	Bugs Fixed/Changes	Note
v2.6	N/A	N/A	PT-G7509 Series	New Features: N/A Enhancements: 1. Added Chain port LED display.	Bugs Fixed: N/A Changes: N/A	N/A
v1.1	N/A	N/A	PT-G7509 Series	New Features: 1. New release for the PT-G7509 Series. 2. Supports TurboPack™ 2009 (add new functions for Turbo Chain, IPv6, Modbus/TCP, IEEE 1588 PTP, SNMP Inform, LLDP, DHCP Option 82, Firefox, and SSH), and VLAN unaware mode. Enhancements: N/A	Bugs Fixed: N/A Changes: N/A	N/A